


Project Number: Tracking Code: TC067--0942

Requested by: John Riley Date: 2/17/2006 Product Rev: 2

Part #: MMSS-10-20-S-12.00-D-LUS Lot #: 145819 Tech: Troy Cook/Tony Wagoner

Part description: MMSS-IPL1 Qty to test: 30

Test Start: 04/14/2006 Test Completed: 5/16/2006

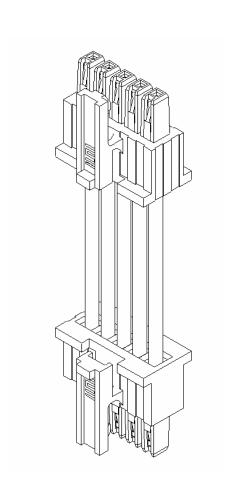

MMSS-IPL1 DVT Report

MMSS-10-20-S-12.00-D-LUS mated with IPL1-110-01-XX-S

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
Part description	o: MMSS_IDI 1

CERTIFICATION

All instruments and measuring equipment were calibrated to National Institute for Standards and Technology (NIST) traceable standards according to ISO 10012-1 and ANSI/NCSL 2540-1, as applicable.

All contents contained herein are the property of Samtec. No portion of this report, in part or in full shall be reproduced without prior written approval of Samtec.

SCOPE

To perform the following tests: Modified DVT to match PMSS-IPBT


APPLICABLE DOCUMENTS

Standards: EIA Publication 364

TEST SAMPLES AND PREPARATION

- 1) All materials were manufactured in accordance with the applicable product specification.
- 2) All test samples were identified and encoded to maintain traceability throughout the test sequences.
- 3) After soldering, the parts to be used for LLCR and DWV/IR testing were cleaned according to TLWI-0001.
- 4) Either an automated cleaning procedure or an ultrasonic cleaning procedure may be used.
- 5) The automated procedure is used with aqueous compatible soldering materials.
- 6) The ultrasonic procedure can be used with either aqueous or non-aqueous soldering components and follows:
 - a. Sample test boards are to be ultrasonically cleaned after test lead attachment, preparation and/or soldering.
 - b. Sample test boards are immersed into Branson 3510 cleaner containing Kyzen Ionox HC1 (or equivalent) with the following conditions:
 - i. Temperature: -----55° C+/- 5° C
 - ii. Frequency:-----40 KHz
 - iii. Immersion Time: ---5 to 10 Minutes
 - c. Sample test boards are removed and placed into the Branson 3510 cleaner containing deionized water with the following conditions:
 - i. Temperature: -----55° C +/- 5° C
 - ii. Frequency:-----40 KHz
 - iii. Immersion Time: ---5 to 10 Minutes
 - d. Sample test boards are removed and placed in a beaker positioned on a hot plate with a magnetic stirrer containing deionized water warmed to 55° C +/- 5° C for 1/2 to 1 minute.
 - e. Upon removal, the sample boards are rinsed for ½ to 1 minute at room temperature with free flowing deionized water.
 - f. After the final rinse, the sample test boards are dried in an air-circulating oven for 10 to 15 minutes at 50° C +/- 5° C.
 - g. Sample test boards are then allowed to set and recover to room ambient condition prior to testing.
- 7) Parts not intended for testing LLCR and DWV/IR are visually inspected and cleaned if necessary.
- 8) Any additional preparation will be noted in the individual test sequences.
- 9) Solder Information:
- 10) Re-Flow Time/Temp: See accompanying profile.
- 11) Internal Test PCBs used: PCB-100375-TST-XX

OVEN PROFILE (Soldering Parts to Test Boards)

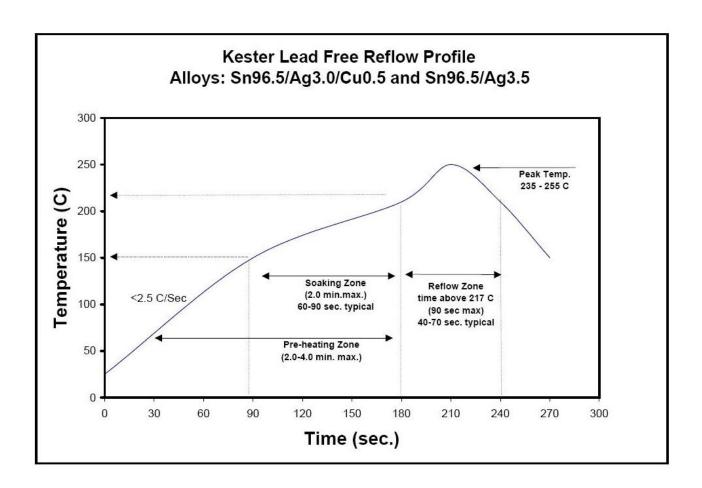

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
Part description	n: MMSS-IPL1

FLOWCHARTS

Current Carrying Capacity

TEST	GROUP A
STEP	1 connector min
	6 contacts powered
01	CCC

Tabulate calculated current at RT, 75° C, 95° C and 115° C after derating 20% and based on 125° C CCC, Temp rise = EIA-364-70

Mating/Unmating/Normal Force

TEST	GROUP A	GROUP B1	GROUP B2
STEP	10 Connectors	5 Connectors	5 Connectors
	50 Cycles		
01	Contact Gaps	Setup Approve	Setup Approve
02	Mating / Unmating	Normal Force	Thermal Aging (Mated)
03	Data Review	Data Review	Normal Force
04	50 Cycles		
05	Mating / Unmating		
06	Contact Gaps		
07	Data Review		
08	Thermal Aging (Mated)		
09	Mating / Unmating		
10	Contact Gaps		
11	Data Review		
12	Humidity (Mated)		
13	Mating / Unmating		
14	Contact Gaps		

Thermal Aging = EIA-364-17, Test Condition 4, 105 deg C;

Time Condition 'B' (250 hours)

Humidity =EIA-364-31, Test Condition 'B' (240 Hours)

and Method III (+25 $^{\circ}$ C to +65 $^{\circ}$ C @ 90%RH to 98% RH)

ambient pre-condition and delete steps 7a and 7b

Mating/Un-Mating Forces = EIA-364-13

Normal Force = EIA-364-04

Contact Gaps/Height - No standard method. Usually measured optically

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
Part descriptio	n: MMSS-IPL1

FLOWCHARTS Continued

IR / DWV

TEST	GROUP A	GROUP B1	GROUP B2	GROUP B3
STEP	3 Connectors	3 Connectors	3 Connectors	3 Connectors
	Ambient	Ambient	Thermal	Humidity
01	IR	DWV/Working Voltage	Thermal Aging	Humidity
02	Data Review		DWV/Working Voltage	DWV/Working Voltage
03	Thermal Aging	'		
04	IR			
05	Data Review			
06	Humidity			
07	IR			

Thermal Aging = EIA-364-17, Test Condition 4, 105 deg C;

Time Condition 'B' (250 hours)

Humidity =EIA-364-31, Test Condition 'B' (240 Hours)

and Method III (+25 $^{\circ}$ C to +65 $^{\circ}$ C @ 90%RH to 98% RH)

ambient pre-condition and delete steps 7a and 7b

IR = EIA-364-21 DWV = EIA-364-20

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS	
Part description: MMSS IPI 1		

ATTRIBUTE DEFINITIONS

The following is a brief, simplified description of attributes.

THERMAL:

- 1) EIA-364-17, Temperature Life with or without Electrical Load Test Procedure for Electrical Connectors.
- 2) Test Condition 4 at 105° C.
- 3) Test Time Condition B for 250 hours.
- 4) Connectors are sometimes mated and all samples are pre-conditioned at ambient.

HUMIDITY:

- 1) Reference document: EIA-364-31, *Humidity Test Procedure for Electrical Connectors*.
- 2) Test Condition B, 240 Hours.
- 3) Method III, +25° C to +65° C, 90% to 98% Relative Humidity excluding sub-cycles 7a and 7b.
- 4) Connectors are sometimes mated and all samples are pre-conditioned at ambient.

TEMPERATURE RISE (Current Carrying Capacity, CCC):

- 1) EIA-364-70, Temperature Rise versus Current Test Procedure for Electrical Connectors and Sockets.
- 2) When current passes through a contact, the temperature of the contact increases as a result of I^2R (resistive) heating.
- 3) The number of contacts being investigated plays a significant part in power dissipation and therefore temperature rise.
- 4) The size of the temperature probe can affect the measured temperature.
- 5) Copper traces on PC boards will contribute to temperature rise:
 - a. Self heating (resistive)
 - b. Reduction in heat sink capacity affecting the heated contacts
- 6) A de-rating curve, usually 20%, is calculated.
- 7) Calculated de-rated currents at three temperature points are reported:
 - a. Ambient
 - b. 75° C
 - c. 95° C
 - d. 115° C
- 8) Typically, neighboring contacts (in close proximity to maximize heat build up) are energized.
- 9) The thermocouple (or temperature measuring probe) will be positioned at a location to sense the maximum temperature in the vicinity of the heat generation area.
- 10) A computer program, TR 803.exe, ensures accurate stability for data acquisition.
- 11) Hook-up wire cross section is larger than the cross section of any connector leads/PC board traces, jumpers, etc.
- 12) Hook-up wire length is longer than the minimum specified in the referencing standard.

CONTACT GAPS:

- 1) Contact gaps were measured before and after stressing the contacts (e.g. thermal aging, mechanical cycling, etc.).
- 2) Typically, all contacts on the connector are measured.

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
Part description	n: MMSS-IPL1

MATING/UNMATING:

- 1) Reference document: EIA-364-13, Mating and Unmating Forces Test Procedure for Electrical Connectors.
- 2) The full insertion position was to within 0.003" to 0.004" of the plug bottoming out in the receptacle to prevent damage to the system under test.
- 3) One of the mating parts is secured to a floating X-Y table to prevent damage during cycling.

NORMAL FORCE (FOR CONTACTS TESTED OUTSIDE THE HOUSING):

- 1) Reference document: EIA-364-04, Normal Force Test Procedure for Electrical Connectors.
- 2) The contacts shall be tested in the loose state, *not* inserted in connector housing.
- 3) The contacts shall be prepared to allow access to the spring member at the same attitude and deflection level as would occur in actual use.
- 4) In the event that portions of the contact prevent insertion of the test probe and/or deflection of the spring member under evaluation, said material shall be removed leaving the appropriate contact surfaces exposed.
- 5) In the case of multi-tine contacts, each tine shall be tested independently on separate samples as required.
- 6) The connector housing shall be simulated, if required, in order to provide an accurate representation of the actual contact system performance.
- 7) A holding fixture shall be fashioned to allow the contact to be properly deflected.
- 8) Said holding fixture shall be mounted on a floating, adjustable, X-Y table on the base of the Dillon TC², computer controlled test stand with a deflection measurement system accuracy of 5 μm (0.0002").
- 9) The probe shall be attached to a Dillon P/N 49761-0105, 5 N (1.1 Lb) load cell providing an accuracy of \pm 0.2%.
- 10) The nominal deflection rate shall be 5 mm (0.2")/minute.
- 11) Unless otherwise noted a minimum of five contacts shall be tested.
- 12) The force/deflection characteristic to load and unload each contact shall be repeated five times.
- 13) The system shall utilize the TC² software in order to acquire and record the test data.
- 14) The permanent set of each contact shall be measured within the TC² software.
- 15) The acquired data shall be graphed with the deflection data on the X-axis and the force data on the Y-axis and a print out will be stored with the Tracking Code paperwork.

INSULATION RESISTANCE (IR):

To determine the resistance of insulation materials to leakage of current through or on the surface of these materials when a DC potential is applied.

- 1) PROCEDURE:
 - a. Reference document: EIA-364-21, Insulation Resistance Test Procedure for Electrical Connectors.
 - b. Test Conditions:
 - i. Between Adjacent Contacts
 - ii. Electrification Time 2.0 minutes
 - iii. Test Voltage (500 VDC) corresponds to calibration settings for measuring resistances.
- 2) MEASUREMENTS:
- 3) When the specified test voltage is applied (VDC), the insulation resistance shall not be less than 5000 megohms.

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
Part descriptio	n: MMSS-IPL1

DIELECTRIC WITHSTANDING VOLTAGE (DWV):

To determine if the sockets can operate at its rated voltage and withstand momentary over potentials due to switching, surges, and other similar phenomenon. Separate samples are used to evaluate the effect of environmental stresses so not to influence the readings from arcing that occurs during the measurement process.

- 1) PROCEDURE:
 - a. Reference document: EIA-364-20, Withstanding Voltage Test Procedure for Electrical Connectors.
 - b. Test Conditions:
 - i. Between Adjacent Contacts
 - ii. Rate of Application 500 V/Sec
 - iii. Test Voltage (VAC) until breakdown occurs
- 2) MEASUREMENTS/CALCULATIONS
 - a. The breakdown voltage shall be measured and recorded.
 - b. The dielectric withstanding voltage shall be recorded as 75% of the minimum breakdown voltage.
 - **c.** The working voltage shall be recorded as one-third (1/3) of the dielectric withstanding voltage (one-fourth of the breakdown voltage).

Tracking Code: TC067--0942 Part #: MMSS-10-20-S-12.00-D-LUS

Part description: MMSS-IPL1

RESULTS

Temperature Rise, CCC at a 20% de-rating

• CCC for a 30°C Temperature Rise------3.6 A per contact with 6 adjacent contacts powered

Contact Gaps

- Initial
 - o Min-----.0165"
 - o Max -----.0178"
- After 50 Cycles
 - Min-----.0168"
 - o Max -----.0178"
- Thermal
 - o Min-----.0189"
 - o Max -----.0200"
- Humidity
 - o Min-----.0193"
 - o Max -----.0210"

Mating – Unmating Forces

- Initial
 - Mating
 - Min ----- 1.3 Lbs.
 - Max----- 2.4 Lbs.
 - o Unmating
 - Min ------ 1.3 Lbs.
 - Max----- 2.3 Lbs.
- After 50 Cycles
 - Mating
 - Min ----- 1.3 Lbs.
 - Max-----2.1 Lbs.
 - Unmating
 - Min ------ 1.3 Lbs.
 - Max-----2.3 Lbs.
- Thermal
 - Mating
 - Min ----- 0.7 Lbs.
 - Max------ 1.6 Lbs.
 - o Unmating
 - Min ----- 0.9 Lbs.
 - Max-----1.6 Lbs.
- Humidity
 - o Mating
 - Min ----- 0.7 Lbs.
 - Max------1.1 Lbs.
 - Unmating
 - Min ----- 0.7 Lbs
 - Max-----1.2 Lbs.

	Tracking Code: TC0670942		Part #: MMSS-10-20-S-12.00-D-LUS
Part description: MMSS-IPL1		L1	
ormal Force a	nt .005" deflection		
T *4* 1			
 Initial 			
• Initial o	Min	59.5 grams	Set0004"
	Min Max	59.5 grams	Set0004" Set0007"
0	Max	59.5 grams 68.8 grams	Set0004" Set0007"
0	Max	68.8 grams	Set0004" Set0007"

Mated------Pass

Dielectric Withstanding Voltage minimums, DWV

Initial

Initial

o l Thermal

UHumidity

0

0

- Breakdown
 - Mated ------1,600 VAC

Unmated ------100,000 Meg Ω

Mated ------ 50,000 Meg Ω Unmated ------100,000 Meg Ω

Mated------15.000 Meg Ω

Unmated ----- 50,000 Meg Ω


- Unmated-----2,500 VAC
- o **DWV**
 - Mated -----1,200 VAC
 - Unmated------1,875 VAC
- Working voltage
 - Mated ------400 VAC
 - Unmated------625 VAC
- Thermal
 - o Breakdown
 - Mated -----1,700 VAC
 - Unmated------1,700 VAC
 - o **DWV**
 - Mated ------1,275 VAC
 - Unmated------1,275 VAC
 - Working voltage
 - Mated ------425 VAC
 - Unmated------425 VAC
- Humidity
 - o Breakdown
 - Mated -----1,500 VAC
 - Unmated------1,500 VAC
 - o DWV
 - Mated -----1,125 VAC
 - Unmated------1,125 VAC
 - Working voltage
 - Mated ------375 VAC
 - Unmated------375 VAC

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS	
Part description: MMSS-IPI 1		

DATA SUMMARIES

TEMPERATURE RISE (Current Carrying Capacity, CCC):

- 1) High quality thermocouples whose temperature slopes track one another were used for temperature monitoring.
- 2) The thermocouples were placed at a location to sense the maximum temperature generated during testing.
- 3) Temperature readings recorded are those for which three successive readings, 15 minutes apart, differ less than 1° C (computer controlled data acquisition).
- 4) Adjacent contacts were powered:
 - a. Linear configuration with SIX (6) adjacent conductors/contacts powered

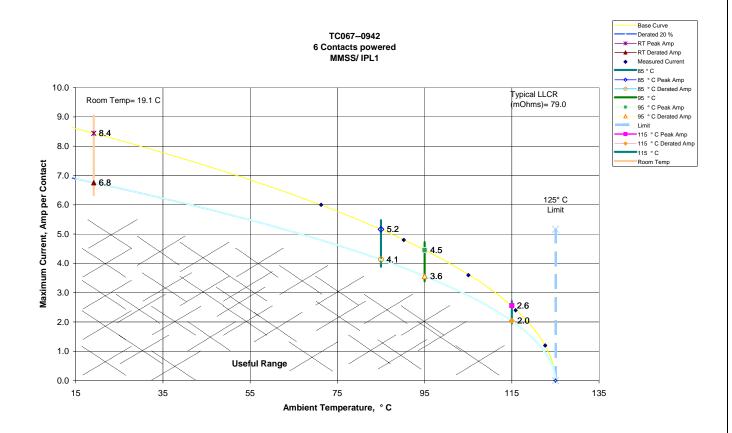

Tracking Code: TC067--0942 Part #: MMSS-10-20-S-12.00-D-LUS

Part description: MMSS-IPL1

DATA SUMMARIES Continued

CONTACT GAPS:

Initial		
Measurements in inches		
Minimum	0.0165	
Maximum 0.0178		
Average 0.0171		
St. Dev. 0.0002		

After 50 Cyc Measurement i	_
Minimum	0.0168
Maximum	0.0178
Average	0.0173
St. Dev.	0.0002

After Therm	nals
Measurement i	n inches
Minimum	0.0189
Maximum	0.0200
Average	0.0194
St. Dev.	0.0002


After Humic	_
Minimum	0.0193
Maximum	0.0210
Average	0.0201
St. Dev.	0.0002

MATING/UNMATING:

		Ini	tial			After 50 Cycles				
	Ma	ting	Unm	ating	Ma	ting	Unmating			
	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)		
Minimum	20.0	1.25	20.0	1.25	21.3	1.33	20.0	1.25		
Maximum	38.6	2.4	36.2	2.3	34.1	2.1	37.4	2.3		
Average	28.5	1.8	26.1	1.6	26.5	1.7	26.7	1.7		
		After T	hermal		After Humidity					
	Ma	ting	Unm	ating	Ma	ting	Unmating			
	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)		
Minimum	11.8	0.7	13.9	0.9	10.7	0.7	10.7	0.7		
Maximum	25.6	1.6	26.3	1.6	17.3	1.1	18.7	1.2		
Average	16.3	1.0	18.1	1.1	13.9	0.9	14.7	0.9		

DATA SUMMARIES Continued

Mating/Unmating Compare

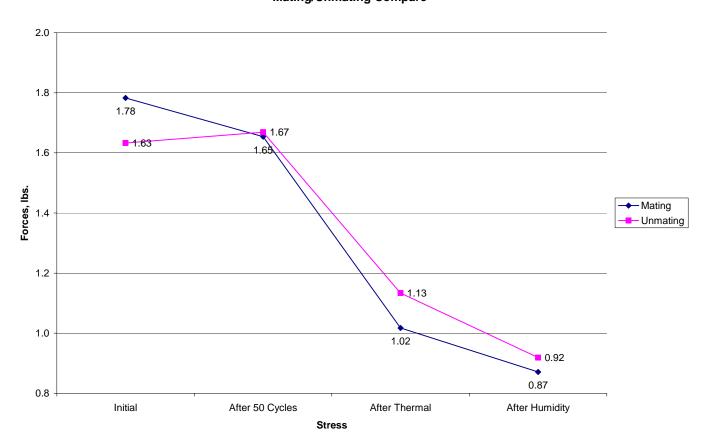

NORMAL FORCE (FOR CONTACTS TESTED OUTSIDE THE HOUSING):


- 1) Calibrated force gauges are used along with computer controlled positioning equipment.
- 2) Typically, 8-10 readings are taken and the averages reported.

Initial		Det	flections in inch	es Forces in Gra	nms	
	0.0010	0.0020	0.0030	0.0040	0.0050	<u>SET</u>
Averages	8.94	22.04	34.81	48.25	65.30	0.0005
Min	6.84	19.90	31.64	43.82	59.54	0.0004
Max	10.82	24.99	38.28	52.23	68.84	0.0007
St. Dev	1.42	2.07	2.77	3.16	3.45	0.0001
Count	6	6	6	6	6	6

Thermals		Det	flections in inch	es Forces in Gra	nms	
	0.0010	0.0020	0.0030	0.0040	0.0050	<u>SET</u>
Averages	9.90	24.49	38.48	51.69	68.61	0.0004
Min	8.90	23.60	35.85	42.93	56.80	0.0002
Max	10.80	25.70	42.00	56.60	75.00	0.0007
St. Dev	0.61	0.78	2.34	4.78	6.31	0.0002
Count	7	7	7	7	7	7

DATA SUMMARIES Continued

Normal Force Compare

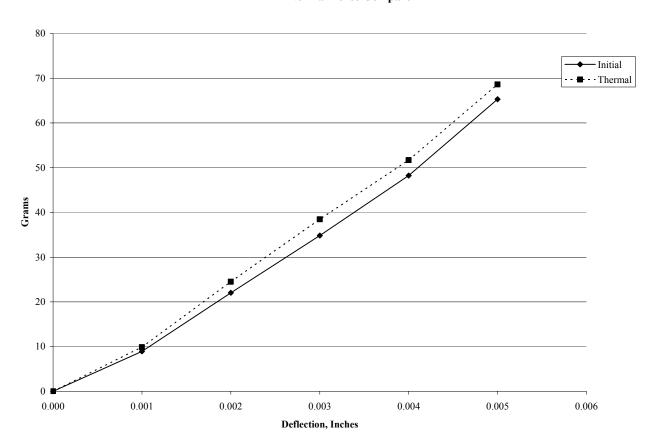

INSULATION RESISTANCE (IR):

	Initial, M	leg Ohms		Thermal,	Meg Ohms		Humidity, Meg Ohms			
		IPL1	MMSS	IPL1		MMSS		IPL1	MMSS	
	Mated	Unmated	Unmated	Mated	Unmated	Unmated	Mated	Unmated	Unmated	
	<u>Insulation</u>	Insulation	Insulation	Insulation	Insulation	Insulation	<u>Insulation</u>	Insulation	<u>Insulation</u>	
	Resistance	Resistance	Resistance							
Average	100000	100000	83333	83333	100000	100000	30000	83333	66667	
Min	100000	100000	50000	50000	100000	100000	15000	50000	50000	
Max	100000	100000	100000	100000	100000	100000	50000	100000	100000	

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
Part description	n: MMSS-IPL1

DATA SUMMARIES Continued

DIELECTRIC WITHSTANDING VOLTAGE (DWV):

	Ini	tial, VAC Ma	ted	Initial, \	VAC Unmated	I MMSS	Initial, VAC Unmated IPL1		
	Breakdown		Working	Breakdown		Working	Breakdown		Working
	<u>Voltage</u>	<u>DWV</u>	Voltage	Voltage	<u>DWV</u>	Voltage	<u>Voltage</u>	<u>DWV</u>	Voltage
Average	1650	1238	413	1700	1275	425	2500	1875	625
Min	1600	1200	400	1600	1200	400	2500	1875	625
Max	1700	1275	425	1900	1425	475	2500	1875	625

	The	rmal, VAC M	ated	Thermal,	VAC Unmate	ed MMSS	Thermal, VAC Unmated IPL1		
	Breakdown		<u>Working</u>	Breakdown		<u>Working</u>	<u>Breakdown</u>		Working
	<u>Voltage</u>	<u>DWV</u>	Voltage	<u>Voltage</u>	<u>DWV</u>	Voltage	<u>Voltage</u>	<u>DWV</u>	Voltage
Average	1800	1350	450	1900	1425	475	1700	1275	425
Min	1700	1275	425	1900	1425	475	1700	1275	425
Max	1900	1425	475	1900	1425	475	1700	1275	425

	Hun	nidity, VAC M	ated	Humidity	, VAC Unmat	ed MMSS	Humidity, VAC Unmated IPL1		
	Breakdown		Working	Breakdown		<u>Working</u>	Breakdown		Working
	Voltage	$\underline{\mathbf{DWV}}$	Voltage	Voltage	$\overline{\mathbf{DWV}}$	Voltage	Voltage	DWV	Voltage
Average	1550	1163	388	1633	1225	408	1950	1463	488
Min	1500	1125	375	1600	1200	400	1500	1125	375
Max	1600	1200	400	1700	1275	425	2400	1800	600

DATA

CONTACT GAPS:

	Initial									
Measure	ments in	inches								
Sample#	<u>B1</u>	<u>B2</u>	<u>B3</u>	<u>B4</u>	<u>B5</u>	<u>B6</u>	<u>B7</u>	<u>B8</u>	<u>B9</u>	<u>B10</u>
1	0.0174	0.0168	0.0173	0.0172	0.0171	0.0169	0.0171	0.0169	0.0170	0.0169
2	0.0171	0.0173	0.0173	0.0169	0.0174	0.0173	0.0171	0.0168	0.0173	0.0169
3	0.0173	0.0169	0.0173	0.0169	0.0171	0.0169	0.0170	0.0170	0.0173	0.0168
4	0.0172	0.0165	0.0170	0.0167	0.0170	0.0174	0.0173	0.0171	0.0169	0.0168
5	0.0170	0.0173	0.0172	0.0168	0.0175	0.0170	0.0169	0.0171	0.0169	0.0168
6	0.0172	0.0170	0.0170	0.0168	0.0171	0.0168	0.0172	0.0168	0.0173	0.0170
7	0.0175	0.0173	0.0171	0.0171	0.0173	0.0174	0.0172	0.0173	0.0172	0.0171
8	0.0173	0.0174	0.0169	0.0168	0.0175	0.0173	0.0173	0.0172	0.0174	0.0168
9	0.0178	0.0171	0.0171	0.0169	0.0169	0.0173	0.0173	0.0172	0.0171	0.0168
10	0.0169	0.0172	0.0172	0.0169	0.0170	0.0170	0.0174	0.0171	0.0170	0.0170
Afte	er 50 Cycles	•								
Measure		_								
Sample#	B1	B2	В3	B4	B5	В6	В7	В8	В9	B10
1	0.0173	0.0171	0.0174	0.0174	0.0176	0.0173	0.0168	0.0172	0.0174	0.0172
2	0.0173	0.0171	0.0174	0.0174	0.0176	0.0173	0.0177	0.0172	0.0174	0.0172
3	0.0174	0.0171	0.0175	0.0172	0.0176	0.0176	0.0177	0.0168	0.0177	0.0170
4	0.0173	0.0172	0.0173	0.0172	0.0176	0.0174	0.0172	0.0171	0.0177	0.0178
5	0.0173	0.0174	0.0174	0.0172	0.0178	0.0174	0.0174	0.0171	0.0175	0.0170
6	0.0173	0.0174	0.0170	0.0172	0.0173	0.0172	0.0170	0.0171	0.0175	0.0170
7	0.0173	0.0174	0.0170	0.0172	0.0173	0.0171	0.0171	0.0173	0.0173	0.0172
	0.0173	0.0174	0.0174	0.0174	0.0177	0.0171	0.0173	0.0174	0.0174	0.0171
9 10	0.0170	0.0170	0.0174	0.0173	0.0171	0.0171	0.0173	0.0173	0.0175	0.0169
	0.0173	0.0174	0.0173	0.0175	0.0175	0.0173	0.0173	0.0168	0.0172	0.0173
Measure	er Thermals ments in									
Sample#	<u>B1</u>	<u>B2</u>	<u>B3</u>	<u>B4</u>	<u>B5</u>	<u>B6</u>	<u>B7</u>	<u>B8</u>	<u>B9</u>	<u>B10</u>
1	0.0198	0.0195	0.0194	0.0195	0.0194	0.0196	0.0194	0.0192	0.0197	0.0194
2	0.0199	0.0195	0.0191	0.0189	0.0194	0.0195	0.0195	0.0193	0.0193	0.0190
3	0.0197	0.0195	0.0191	0.0189	0.0196	0.0195	0.0194	0.0193	0.0196	0.0190
4	0.0197	0.0192	0.0192	0.0104	0.0400		0.0400	0.0195	0.0400	0.0190
5	0.0195		0.0.0	0.0194	0.0192	0.0193	0.0198	0.0193	0.0192	0.0100
6		0.0192	0.0191	0.0194	0.0192	0.0193 0.0193	0.0198	0.0194	0.0192	
-	0.0197	0.0192 0.0191								0.0193
7			0.0191	0.0194	0.0196	0.0193	0.0194	0.0194	0.0191	0.0193 0.0192
	0.0197	0.0191	0.0191 0.0193	0.0194 0.0195	0.0196 0.0196	0.0193 0.0192	0.0194 0.0195	0.0194 0.0194	0.0191 0.0195	0.0193 0.0192 0.0193
7	0.0197 0.0192	0.0191 0.0193	0.0191 0.0193 0.0190	0.0194 0.0195 0.0190	0.0196 0.0196 0.0195	0.0193 0.0192 0.0198	0.0194 0.0195 0.0198	0.0194 0.0194 0.0195	0.0191 0.0195 0.0197	0.0193 0.0192 0.0193 0.0193 0.0189
7 8	0.0197 0.0192 0.0199	0.0191 0.0193 0.0192	0.0191 0.0193 0.0190 0.0192	0.0194 0.0195 0.0190 0.0192	0.0196 0.0196 0.0195 0.0198	0.0193 0.0192 0.0198 0.0197	0.0194 0.0195 0.0198 0.0198	0.0194 0.0194 0.0195 0.0195	0.0191 0.0195 0.0197 0.0194	0.0193 0.0192 0.0193 0.0193
7 8 9 10	0.0197 0.0192 0.0199 0.0194	0.0191 0.0193 0.0192 0.0193 0.0193	0.0191 0.0193 0.0190 0.0192 0.0191	0.0194 0.0195 0.0190 0.0192 0.0198	0.0196 0.0196 0.0195 0.0198 0.0197	0.0193 0.0192 0.0198 0.0197 0.0195	0.0194 0.0195 0.0198 0.0198 0.0194	0.0194 0.0194 0.0195 0.0195 0.0199	0.0191 0.0195 0.0197 0.0194 0.0197	0.0193 0.0192 0.0193 0.0193 0.0189
7 8 9 10	0.0197 0.0192 0.0199 0.0194 0.0195	0.0191 0.0193 0.0192 0.0193 0.0193	0.0191 0.0193 0.0190 0.0192 0.0191	0.0194 0.0195 0.0190 0.0192 0.0198	0.0196 0.0196 0.0195 0.0198 0.0197	0.0193 0.0192 0.0198 0.0197 0.0195	0.0194 0.0195 0.0198 0.0198 0.0194	0.0194 0.0194 0.0195 0.0195 0.0199	0.0191 0.0195 0.0197 0.0194 0.0197	0.0193 0.0192 0.0193 0.0193 0.0189
7 8 9 10	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidity	0.0191 0.0193 0.0192 0.0193 0.0193	0.0191 0.0193 0.0190 0.0192 0.0191	0.0194 0.0195 0.0190 0.0192 0.0198	0.0196 0.0196 0.0195 0.0198 0.0197	0.0193 0.0192 0.0198 0.0197 0.0195	0.0194 0.0195 0.0198 0.0198 0.0194	0.0194 0.0194 0.0195 0.0195 0.0199	0.0191 0.0195 0.0197 0.0194 0.0197	0.0193 0.0192 0.0193 0.0193 0.0189
7 8 9 10 Afte Measure	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidity ments in	0.0191 0.0193 0.0192 0.0193 0.0193 inches	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196	0.0193 0.0192 0.0193 0.0193 0.0189 0.0190
7 8 9 10 Aftr Measurer Sample#	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidity ments in B1	0.0191 0.0193 0.0192 0.0193 0.0193 inches	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196	0.0193 0.0192 0.0193 0.0193 0.0189 0.0190 B10 0.0205
7 8 9 10 Aftr Measurer Sample#	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidity ments in B1 0.0199	0.0191 0.0193 0.0192 0.0193 0.0193 inches B2 0.0202	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193 B3 0.0199	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195 <u>B4</u> 0.0198	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199 B5 0.0206	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193 B6 0.0200	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195 B7 0.0205	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200 B8 0.0205	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196 B9 0.0203	0.0193 0.0192 0.0193 0.0193 0.0189 0.0190 B10 0.0205 0.0199
7 8 9 10 Afte Measurer Sample# 1 2 3	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidityments in B1 0.0199 0.0201 0.0200	0.0191 0.0193 0.0192 0.0193 0.0193 inches B2 0.0202 0.0200	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193 B3 0.0199 0.0197 0.0195	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195 B4 0.0198 0.0198 0.0199	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199 B5 0.0206 0.0209 0.0208	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193 B6 0.0200 0.0197 0.0198	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195 B7 0.0205 0.0204 0.0204	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200 B8 0.0205 0.0205 0.0201	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196 B9 0.0203 0.0204 0.0200	0.0193 0.0192 0.0193 0.0189 0.0190 B10 0.0205 0.0199 0.0198
7 8 9 10 Afte Measurel Sample# 1 2 3	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidityments in B1 0.0199 0.0201 0.0200	0.0191 0.0193 0.0192 0.0193 0.0193 inches B2 0.0202 0.0200 0.0204 0.0208	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193 B3 0.0199 0.0197 0.0195 0.0197	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195 B4 0.0198 0.0198 0.0199 0.0199	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199 B5 0.0206 0.0209 0.0208 0.0203	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193 B6 0.0200 0.0197 0.0198 0.0199	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195 B7 0.0205 0.0204 0.0204	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200 B8 0.0205 0.0205 0.0201 0.0203	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196 B9 0.0203 0.0204 0.0200 0.0198	0.0193 0.0192 0.0193 0.0193 0.0189 0.0190 B10 0.0205 0.0199 0.0198
7 8 9 10 Afte Measure Sample# 1 2 3 4 5	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidityments in B1 0.0199 0.0201 0.0200 0.0201 0.0203	0.0191 0.0193 0.0192 0.0193 0.0193 inches B2 0.0202 0.0200 0.0204 0.0208 0.0201	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193 B3 0.0199 0.0197 0.0195 0.0197	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195 B4 0.0198 0.0198 0.0199 0.0199 0.0195	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199 B5 0.0206 0.0209 0.0208 0.0203 0.0209	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193 B6 0.0200 0.0197 0.0198 0.0199 0.0197	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195 0.0205 0.0204 0.0204 0.0204 0.0204	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200 B8 0.0205 0.0205 0.0201 0.0203 0.0200	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196 B9 0.0203 0.0204 0.0200 0.0198 0.0199	0.0193 0.0192 0.0193 0.0189 0.0190 B10 0.0205 0.0199 0.0198 0.0196 0.0200
7 8 9 10 Afte Measure Sample# 1 2 3 4 5 6	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidityments in B1 0.0199 0.0201 0.0200 0.0203 0.0199	0.0191 0.0193 0.0192 0.0193 0.0193 0.0193 inches B2 0.0202 0.0200 0.0204 0.0208 0.0201 0.0198	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193 B3 0.0199 0.0197 0.0197 0.0197 0.0197	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195 B4 0.0198 0.0198 0.0199 0.0199 0.0198 0.0198	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199 0.0206 0.0209 0.0208 0.0203 0.0209 0.0205	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193 B6 0.0200 0.0197 0.0198 0.0199 0.0199	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195 B7 0.0205 0.0204 0.0204 0.0204 0.0201	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200 B8 0.0205 0.0205 0.0201 0.0203 0.0200 0.0203	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196 B9 0.0203 0.0204 0.0200 0.0198 0.0199 0.0200	0.0193 0.0192 0.0193 0.0199 0.0190 B10 0.0205 0.0199 0.0198 0.0196 0.0200 0.0201
7 8 9 10 Afte Measure Sample# 1 2 3 4 5 6 7	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidityments in B1 0.0199 0.0201 0.0200 0.0201 0.0203 0.0199 0.0200	0.0191 0.0193 0.0192 0.0193 0.0193 0.0193 inches B2 0.0202 0.0200 0.0204 0.0208 0.0201 0.0198 0.0203	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193 B3 0.0199 0.0197 0.0195 0.0197 0.0197 0.0193 0.0195	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195 B4 0.0198 0.0198 0.0199 0.0195 0.0198 0.0198 0.0198	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199 B5 0.0206 0.0209 0.0208 0.0203 0.0205 0.0210	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193 B6 0.0200 0.0197 0.0198 0.0199 0.0199 0.0199	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195 B7 0.0205 0.0204 0.0204 0.0204 0.0201 0.0201 0.0208	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200 B8 0.0205 0.0205 0.0201 0.0203 0.0203 0.0203	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196 B9 0.0203 0.0204 0.0200 0.0198 0.0199 0.0200 0.0197	0.0193 0.0192 0.0193 0.0199 0.0190 B10 0.0205 0.0199 0.0198 0.0200 0.0200 0.0201
7 8 9 10 Afte Measure Sample# 1 2 3 4 5 6	0.0197 0.0192 0.0199 0.0194 0.0195 er Humidityments in B1 0.0199 0.0201 0.0200 0.0203 0.0199	0.0191 0.0193 0.0192 0.0193 0.0193 0.0193 inches B2 0.0202 0.0200 0.0204 0.0208 0.0201 0.0198	0.0191 0.0193 0.0190 0.0192 0.0191 0.0193 B3 0.0199 0.0197 0.0197 0.0197 0.0197	0.0194 0.0195 0.0190 0.0192 0.0198 0.0195 B4 0.0198 0.0198 0.0199 0.0199 0.0198 0.0198	0.0196 0.0196 0.0195 0.0198 0.0197 0.0199 0.0206 0.0209 0.0208 0.0203 0.0209 0.0205	0.0193 0.0192 0.0198 0.0197 0.0195 0.0193 B6 0.0200 0.0197 0.0198 0.0199 0.0199	0.0194 0.0195 0.0198 0.0198 0.0194 0.0195 B7 0.0205 0.0204 0.0204 0.0204 0.0201	0.0194 0.0194 0.0195 0.0195 0.0199 0.0200 B8 0.0205 0.0205 0.0201 0.0203 0.0200 0.0203	0.0191 0.0195 0.0197 0.0194 0.0197 0.0196 B9 0.0203 0.0204 0.0200 0.0198 0.0199 0.0200	0.0193 0.0192 0.0193 0.0189 0.0190 B10 0.0205 0.0199 0.0198 0.0196 0.0200

1 racking Code: 1C06/0942 Part #: MIVISS-10-20-S-12.00-D-LUS	Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
--	--------------------------	----------------------------------

DATA Continued

MATING/UNMATING:

		Ini	tial		After 50 Cycles				
	М	ating	Unmating		Ма	ting	Unmating		
Sample#	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	
1	25.3	1.58	20.0	1.25	24.0	1.50	22.7	1.42	
2	26.7	1.67	24.2	1.51	25.8	1.61	25.3	1.58	
3	34.6	2.16	30.7	1.92	34.1	2.13	37.4	2.34	
4	35.7	2.23	36.2	2.26	26.6	1.66	27.8	1.74	
5	32.8	2.05	29.4	1.84	33.1	2.07	33.3	2.08	
6	20.0	1.25	25.4	1.59	21.3	1.33	25.3	1.58	
7	25.3	1.58	22.7	1.42	22.4	1.40	22.7	1.42	
8	38.6	2.41	31.0	1.94	33.4	2.09	32.3	2.02	
9	22.4	1.40	20.3	1.27	21.3	1.33	20.2	1.26	
10	24.0	1.50	21.3	1.33	22.7	1.42	20.0	1.25	

		After T	hermal		After Humidity				
	Ma	ting	Unmating		Mating		Unmating		
Sample#	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	Force (Oz)	Force (Lbs)	
1	11.8	0.74	15.9	0.99	11.5	0.72	15.0	0.94	
2	25.6	1.60	26.3	1.64	10.7	0.67	13.4	0.84	
3	23.9	1.49	24.3	1.52	16.0	1.00	17.4	1.09	
4	18.6	1.16	20.5	1.28	17.3	1.08	18.7	1.17	
5	13.9	0.87	14.8	0.93	14.6	0.91	14.9	0.93	
6	12.1	0.76	13.9	0.87	12.0	0.75	13.4	0.84	
7	12.6	0.79	14.4	0.90	12.0	0.75	10.7	0.67	
8	18.4	1.15	21.8	1.36	16.0	1.00	13.6	0.85	
9	13.8	0.86	14.9	0.93	14.7	0.92	14.9	0.93	
10	12.2	0.76	14.5	0.91	14.6	0.91	14.9	0.93	

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS
Part description	n: MMSS-IPL1

DATA Continued

NORMAL FORCE (FOR CONTACTS TESTED OUTSIDE THE HOUSING):

Initial		Deflections in inches Forces in Grams								
Sample #	0.0010	0.0020	0.0030	0.0040	0.0050	SET				
1	8.16	20.12	31.64	43.82	62.86	0.00050				
2	9.71	19.90	32.30	46.03	59.54	0.00040				
3	9.71	23.44	36.73	50.24	67.29	0.00070				
4	6.84	20.79	33.19	46.92	66.19	0.00040				
5	10.82	24.99	38.28	52.23	68.84	0.00040				
6	8.39	23.00	36.73	50.24	67.07	0.00040				
7										
Thermals	Deflections in inches Forces in Grams									
Sample #	0.0010	0.0020	0.0030	0.0040	0.0050	SET				
1	9.50	24.10	37.60	50.60	69.30	0.00040				
2	8.90	23.60	37.60	52.50	72.30	0.00050				
3	10.30	24.60	39.50	55.20	75.00	0.00040				
4	10.80	25.70	42.00	56.60	73.60	0.00020				
5	9.94	23.67	35.85	48.69	64.19	0.00030				
6	10.16	24.55	36.07	42.93	56.80	0.00070				
7	9.71	25.22	40.72	55.33	69.06	0.00040				

INSULATION RESISTANCE (IR):

	Initia	al, Meg Ohms		Therma	Thermal, Meg Ohms			Humidity, Meg Ohms		
		IPL1	MMSS		IPL1	MMSS		IPL1	MMSS	
	Mated	Unmated	Unmated	Mated	Unmated	Unmated	Mated	Unmated	Unmated	
	<u>Insulation</u>	<u>Insulation</u>								
Sample #	Resistance	Resistance								
1	100000	100000	100000	100000	100000	100000	25000	100000	50000	
2	100000	100000	50000	50000	100000	100000	50000	50000	100000	
3	100000	100000	100000	100000	100000	100000	15000	100000	50000	

Tracking Code: TC0670942 Part #: MMSS-10-20-S-12.00-D-LUS

DATA Continued

DIELECTRIC WITHSTANDING VOLTAGE (DWV):

	Initial	, VAC Ma	ited	Initial, VA	C Unmated	d MMSS	Initial, VA	C Unmat	ed IPL1
Sample #	Breakdown Voltage	DWV	Working Voltage	Breakdown Voltage	DWV	Working Voltage	Breakdown Voltage	DWV	Working Voltage
1	1600	1200	400	1900	1425	475	$\bigg) \bigg\rangle$	\mathbb{X}	><
2	1700	1275	425	1600	1200	400	$\bigg\rangle \bigg\langle$	\times	><
3		><	><	1600	1200	400	2500	1875	625

	Therma	al, VAC M	lated	Thermal, VA	AC Unmat	ed MMSS	Thermal, V	AC Unma	ted IPL1
Sample #	Breakdown Voltage	DWV	Working Voltage	Breakdown Voltage	DWV	Working Voltage	Breakdown Voltage	DWV	Working Voltage
1	1700	1275	425	1900	1425	475	$\bigg) \bigg\rangle$	\nearrow	\nearrow
2	1900	1425	475	1900	1425	475	$\bigg\rangle$	\mathbb{X}	\setminus
3		><	><	1900	1425	475	1700	1275	425

	Humidi	ty, VAC N	Tated	Humidity, V.	Humidity, VAC Unmated MMSS		Humidity, VAC Unmated IPL		
Sample #	Breakdown Voltage	<u>DWV</u>	Working Voltage	Breakdown Voltage	<u>DWV</u>	Working Voltage	Breakdown Voltage	<u>DWV</u>	Working Voltage
1	1500	1125	375	1700	1275	425	$\bigg\rangle$	\setminus	$>\!\!<$
2	1600	1200	400	1600	1200	400	1500	1125	375
3	$\bigg / \bigg /$	\mathbf{X}	\nearrow	1600	1200	400	2400	1800	600

Tracking Code: TC067--0942 Part #: MMSS-10-20-S-12.00-D-LUS

Part description: MMSS-IPL1

EQUIPMENT AND CALIBRATION SCHEDULES

Equipment #: THL-02

Description: Temperature/Humidity Chart Recorder

Manufacturer: Dickson

Model: THDX Serial #: 00120351

Accuracy: Temp: +/- 1C; Humidity: +/-2% RH (0 - 60%) +/- 3% RH (61 - 95%).

... Last Cal: 06/16/06, Next Cal: 06/16/07

Equipment #: MO-02

Description: Multimeter /Data Acquisition System

Manufacturer: Keithley

Model: 2700 Serial #: 0780546 Accuracy: See Manual

... Last Cal: 05/12/06, Next Cal: 05/12/07

Equipment #: MO-04

Description: Multimeter /Data Acquisition System

Manufacturer: Keithley

Model: 2700 Serial #: 0798688 Accuracy: See Manual

... Last Cal: 01/31/06, Next Cal: 01/31/07

Equipment #: TC090601-103/105 **Description:** IC Thermocouple-103/105

Manufacturer: Samtec

Model:

Serial #: TC090601-103/105 Accuracy: +/- 1 degree C ... Last Cal: , Next Cal:

Equipment #: TCT-03

Description: Dillon Quantrol TC2 Test Stand

Manufacturer: Dillon Quantrol

Model: TC2

Serial #: 02-1033-03

Accuracy: Speed Accuracy: +/- 5% of indicated speed; Displacement: +/- 5 micrometers.

... Last Cal: 5/12/06, Next Cal: 5/12/07

Equipment #: LC-2500N(icell)

Description: 2500 N Load Cell for Dillon Quantrol

Manufacturer: Dillon Quantrol

Model: icell

Serial #: 01-0132-01 Accuracy: .10% of capacity

... Last Cal: 6/13/06, Next Cal: 6/13/07

Tracking Code: TC067--0942 Part #: MMSS-10-20-S-12.00-D-LUS

Part description: MMSS-IPL1

Equipment #: OGP-01

Description: 6"X 6" Video Measuring Machine **Manufacturer:** Optical Gauging Products

Model: Smartscope 200 CFOV

Serial #: SF2001956

Accuracy: See Manual See Manual ... Last Cal: 04/12/06, Next Cal: 04/12/05

Equipment #: THC-01

Description: Temperature/Humidity Chamber

Manufacturer: Thermotron

Model: SM-8-7800 Serial #: 30676

Accuracy: See Manual

... Last Cal: 7/15/2005, Next Cal: 8/15/2006

Equipment #: OV-03

Description: Cascade Tek Forced Air Oven

Manufacturer: Cascade Tek

Model: TFO-5 **Serial #:** 0500100

Accuracy: Temp. Stability: +/-.1C/C change in ambient

... Last Cal: 05/12/06, Next Cal: 05/12/07

Equipment #: TCT-04

Description: Dillon Quantrol TC21 25-1000 mm/min series test stand

Manufacturer: Dillon Quantrol **Model:** TC2 I series test stand

Serial #: 04-1041-04

Accuracy: Speed Accuracy: +/- 5% of indicated speed; Speed Accuracy: +/- 5% of indicated speed;

... Last Cal: 05/16/2006, Next Cal: 05/16/2007

Equipment #: LC-5N (icell)-2

Description: 5 Newton load cell for Dillon Quantrol test stand

Manufacturer: Dillon Quantrol

Model: icell Serial #: 00120351

Accuracy: .10 % of capacity

... Last Cal: 5/10/2006, Next Cal: 5/10/2007

Equipment #: HPM-01

Description: Hipot Megommeter **Manufacturer:** Hipotronics

Model: H306B-A **Serial #:** M9905004

Accuracy: 2 % Full Scale Accuracy
... Last Cal: 5/12/06, Next Cal: 05/12/07

Tracking Code: TC0670942	Part #: MMSS-10-20-S-12.00-D-LUS					
Part description: MMSS-IPL1						

Equipment #: PS-01

Description: System Power Supply **Manufacturer:** Hewlett Packard

Model: HP 6033A

Serial #: (HP) 3329A-07330 Accuracy: See Manual

... Last Cal: 05/12/06, Next Cal: 05/12/07

. . .